



The difference between DuroSpeed™ and the competition?

It's all a matter of degrees.



Features & Benefits

- Average 70-degree cooler running temperature means significantly extended bearing and liner life
- Innovative flux ring design dissipates heat 27% better than competing fan clutches
- No spinning air fittings to wear out
- Easy, inexpensive conversion of on/off clutches using our flux ring assembly kit
- 11 fewer components means a more durable clutch that weighs 5-10 pounds less than the competition
- Brand new, coreless design

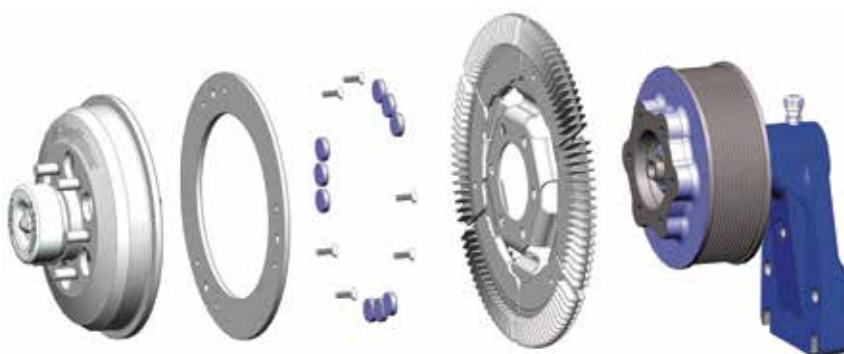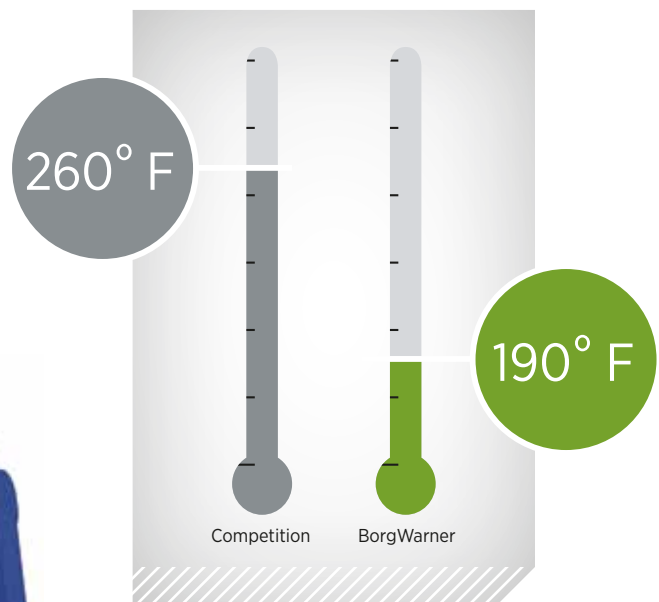

K Series Clutch

Flux Ring Assembly Kit

Hub Assembly

DUROSPEED CROSS REFERENCE					
OEM	Engine	Model	Horton Reman Part#	BorgWarner DuroSpeed	
Kenworth Peterbilt Model Year 2010-2016	Cummins ISX15L	Peterbilt 367, 368, 587, 567-121, 579-123, 387 Kenworth T800W, NGP, T680, NGP, T880, W980, T700, T800B, T660	79A8200	010028657	
		Peterbilt 367HH, 388, 389 Kenworth W900B	79A8201 79A9798	010028673	
		Kenworth NGP T880, NGP T680	79A8117	010028659	
	Cummins ISX12	Peterbilt 367, 386, 567-121, 579-123 Kenworth T800B, T800W, NGP T680, NGP T880, W980, T660	79A8122	010028663	
		Peterbilt 365, 567-115, 579-117, 384 Kenworth T800SH, NGP T680SH, NGP T880SH	79A8121	010028664	
		Peterbilt 579-117 Kenworth NGP T680SH, NGP T880SH	79A8135	010028665	
		Peterbilt 579-123 Kenworth NGP T680SH, NGP T880SH	79A8136	010028666	
	MX10	Peterbilt 384, 365, 587 ¹ Kenworth T800SH, T700 ¹	79A9761	010028443	
		Peterbilt 386, 367, 579-123 Kenworth T800B, NGP T680, T660	79A9762	010028668	
		Peterbilt 367HH, 388, 389 Kenworth W900B	79A9768	010028669	
	MX13	Kenworth NGP T680, NGP T880	79A8112	010028662	
		Peterbilt 567-115, 384, 365, 579-117, 587 ¹ Kenworth T700, NGP T680SH, NGP T880SH, T800SH ¹	79A9761	010028352	
		Peterbilt 386, 567-121, 579-123, 367 Kenworth T800B, NGP T680, W980, T880, T660 Peterbilt 367HH, 388, 389 Kenworth W900B	79A9762 79A9768	010028661 010028658	
	Navistar ISX Model Year 2007-2016	Cummins ISX15	ProStar ²	79A9750	010028521
	Volvo Mack Model Year 2007-2016	D11	Volvo VN	79A9643-2	010027941
MP7		Mack CXU			
D11		Volvo VHD/UFEP TO	79A8180	010027942	
MP7		Mack GU8/UFEP TO			
D11		Volvo VHD	79A9644-2	010027943	
MP7		Mack GU7, GU8/FEPTO			
D13		Volvo VN	79A9644-2	010027944	
MP8		Mack CXU			
D13		Volvo VHD/UFEP TO	79A8184	010027945	
MP8		Mack GU8/UFEP TO, CHU			
D13		Volvo VHD/FEPTO	79A8182	010027946	
MP8		Mack GU8/FEPTO			
MP8		Mack GU7		010027947	
D16		Volvo VN,VT	79A9646-2	010027948	
MP10		Mack TDU			
	Cummins ISX15	Volvo VN	79A9645-2	010027949	
	Cummins ISL9D/ CU9	Mack GU4, GU5		010030467	

¹ Cannot use existing Horton fan. Purchase BorgWarner fan 4735-44510-06. 2 9/16" pilot. Horton fan will not work with DuroSpeed drive.

² BorgWarner fan 4735-44610-01/3809753C2 is required by Navistar for both Horton and BorgWarner drives.